

PRV

PATENT- OCH REGISTRERINGSVERKET
Patentavdelningen

10/525977
PCT/SE 03 / 0 1 3 1 7
PCT/PTO 28 FEB 2005

REC'D 04 SEP 2003

WIPO

PCT

Intyg Certificate

Härmed intygas att bifogade kopior överensstämmer med de handlingar som ursprungligen ingivits till Patent- och registreringsverket i nedannämnda ansökan.

This is to certify that the annexed is a true copy of the documents as originally filed with the Patent- and Registration Office in connection with the following patent application.



(71) Sökande Sandvik AB, Sandviken SE
Applicant (s)

(21) Patentansökningsnummer 0202532-8
Patent application number

(86) Ingivningsdatum 2002-08-28
Date of filing

Stockholm, 2003-08-28

För Patent- och registreringsverket
For the Patent- and Registration Office


Gunilla Larsson

Avgift
Fee

PRIORITY DOCUMENT
SUBMITTED OR TRANSMITTED IN
COMPLIANCE WITH
RULE 17.1(a) OR (b)

**PATENT- OCH
REGISTRERINGSVERKET**
SWEDEN

Postadress/Adress
Box 5055
S-102 42 STOCKHOLM

Telefon/Phone
+46 8 782 25 00
Vx 08-782 25 00

Telex
17978
PATOREG S

Telefax
+46 8 666 02 86
08-666 02 86

AWAPATENT AB

Kontor/Handläggare
Växjö/Erik Simonsson/ESN

SANDVIK AB

Ansökningsnr

Vår referens

SE-2023093

1

A HOLDER FOR A WEAR PART OF A CRUSHER

Technical Field of the Invention

The present invention relates to a tip holder for mounting at an outflow opening of a rotor of a vertical shaft impact crusher, said rotor comprising a vertical rotor wall segment having a first wall portion being substantially tangential in relation to the rotor and a second wall portion being angled in relation to said first wall portion, said tip holder comprising a holding part for holding a wear tip.

The present invention also relates to a method of mounting a tip holder to an outflow opening of a rotor of a vertical shaft impact crusher, said rotor comprising a vertical rotor wall segment having a first wall portion being substantially tangential in relation to the rotor and a second wall portion being angled in relation to said first wall portion, said tip holder comprising a holding part for holding a wear tip.

20 Background Art

Vertical shaft impact crushers (VSI-crushers) are used in many applications for crushing hard material like rocks, ore etc. US 3,154,259 describes a VSI-crusher comprising a housing and a horizontal rotor located inside the housing. Material that is to be crushed is fed into the rotor via an opening in the top thereof. With the aid of centrifugal force the rotating rotor ejects the material against the wall of the housing. On impact with the wall the material is crushed to a desired size. The housing wall could be provided with anvils or have a bed of retained material against which the accelerated material is crushed.

The rotor of a VSI-crusher usually has a horizontal upper disc and a horizontal lower disc. The upper and lower discs are connected with a vertical rotor wall. The upper disc has an aperture for feeding material into the rotor. The material lands on the lower disc and is then thrown out of the rotor via openings in the rotor wall. The vertical rotor walls are provided with wear tips of a hard material, such as a hard metal or a ceramic, to protect them from wear caused by the material leaving the rotor at a high speed.

The wear tips described in US 3,154,259 are fixed to holes in the upper and lower discs.

US 3,174,697 describes impeller shoes for a rotor. The impeller shoes, which each have a hard metal tip, are bolted to a horizontal impeller disc.

GB 2,198,060 describes a carrier body. The carrier body, being a substantially plate shaped body, holds a hard metal tip at one end thereof. At a second end thereof the carrier body is bolted to the rotor wall by a through bolt. The bolt fixing the carrier body in position is subjected to heavy wear.

The wear tips described above are quite difficult to replace when they have become worn out. The down time related to maintenance work is thus rather long. In some cases a bolt wear protection plate is required to protect the bolt holding the wear tip.

Summary of the Invention

It is an object of the present invention to provide a tip holder which decreases the down time required for maintenance of the rotor.

It is another object of the invention to provide a tip holder which makes it possible to reduce the number of wear plates required to protect the tip holder.

A further object of the invention is to provide a tip holder that allows a higher rotor speed and thus

increases the velocity of the material ejected from the rotor.

These objects are achieved with a tip holder according to the preamble and characterised in that a fastening means is attached to the holding part, the fastening means being adapted to extend along said first wall portion and through said second wall portion from one side thereof, a fixing means being detachably fixable to the fastening means at the other side of said second wall portion.

An advantage with the tip holder according to the preamble is that it is easy to mount and to dismount. Inside the rotor a bed of material is built up against the wall segment. Since the fastening means extend along a first wall portion the tip holder may be dismounted without having to remove the bed beforehand. The fact that the fixing means are attached to the fastening means at the other side of the second wall portion decreases the wear and damage to the fastening means. The removal of the fixing means thus becomes easier which further decreases the down-time required for maintenance. With fixing means located inside the bed of material as in many prior art crushers there is always a risk that the fixing means are worn down such that the tip holder falls out of the rotor. This risk is also decreased with the present invention since the fixing means need not be put inside the bed of material. The fastening means must be kept intact both for easy removal of the tip holder and for the possibility of putting the tip holder back at another location in the rotor.

A further advantage is that since the fixing means are detachably fixed at the other side of the second wall portion they are much less subjected to wear. Thus no wear plates protecting the fixing means is required. The absence of such protecting wear plates makes the rotor lighter and allows for a higher rotor speed. Also the lower wear and the absence of said protecting wear plates

will allow the tip holder to locate the wear tip at the absolute periphery of the rotor, thus further increasing the peripheral speed of the wear tip and increasing the speed of the material ejected from the rotor.

5 According to a preferred embodiment the fastening means extends along the radially inner side of said first wall portion. In this way the fastening means are protected from rocks bouncing back from the crusher wall. Also the fastening means assist in building a stable bed
10 of rocks inside the rotor against the rotor wall.

Preferably the tip holder comprises a securing means for removably securing the tip holder to a free vertical edge of said first wall portion. An advantage with this is that the tip holder will be firmly secured at the free
15 edge. There is thus no risk that the tip holder gets bent due to rocks bouncing back from the rotor wall. Still more preferably said securing means comprises a hook adapted for gripping said edge of said first wall portion. A hook makes it easy to provide a strong
20 securing of the tip holder to the first wall portion. The mounting and dismounting of the tip holder also becomes easier since simply sliding the tip holder in or out of position along the first wall portion will make the hook grip or release the vertical edge.

25 According to a preferred embodiment the fastening means comprises at least one shoulder adapted to hold a horizontal wear plate in position. The shoulder assists in holding the wear plate in position and also allows the wear plate to get in close contact with the first wall
30 portion located behind the fastening means. This improves the function of the wear plates and decreases the wear on the rotor walls. Still more preferably the fastening means comprises a lower shoulder and an upper shoulder each being adapted to hold a horizontal wear plate in
35 position. An advantage with this is that the tip holder may hold both an upper and a lower horizontal wear plate in position. It is also possible to change the position

of the individual tip holders in the case several tip holders are mounted at one rotor opening.

Preferably the fastening means comprises a threaded bar intended for extending along said first wall portion and through a hole in said second wall portion. A
5 threaded bar makes the tip holder cheap to manufacture and provides a simple and efficient way of fixing the tip holder. The hole needed in the second wall portion is made by simply drilling a hole. Still more preferably the
10 fixing means comprises a nut which is adapted to provide a tensile stress in the threaded bar when fixing said fixing means to the threaded bar at said other side of the second wall portion. The tensile stress makes the tip holder fit tightly to the rotor opening. The risk that
15 the tip holder would come loose of the rotor is thus reduced. It is also easy to advice a person mounting the tip holder to apply a certain momentum to the nut to obtain a desired fixing force. In the event securing means and/or hooks described above are used as described
20 above the tensile stress tightens the tip holder between the free vertical edge of the first wall portion and the second wall portion.

According to a preferred embodiment the fastening means comprises a surface adapted for the application of
25 a force in a direction parallel to said first wall portion. By applying a force or a strike to the surface the frictional forces of the bed of retained material may be loosened such that the tip holder may easily be removed without having to pick away the entire bed. This
30 makes removal much quicker in cases where the bed of material located against the tip holder is very hard and/or tenacious.

It is another object of the present invention to provide a method of mounting a tip holder which method
35 decreases the down time required for maintenance of the rotor.

This object is achieved with a method according to the preamble characterised in that in that

the tip holder is guided along said first wall portion such that a fastening means attached to the holding part extends along said first wall portion and passes through said second wall portion from one side thereof, and

a fixing means is fixed to the fastening means at the other side of said second wall portion.

An advantage of this method is that the mounting is very quick and provides a proper position of the tip holder at the outflow opening. Another advantage is that a bed of material that has built up inside the rotor against a rotor wall and a tip holder that is to be replaced need not be removed before a new tip holder is put in place by sliding it into position.

These and other aspects of the invention will be apparent from and elucidated with reference to the embodiments described hereafter.

Brief Description of the Drawings

The invention will hereafter be described in more detail and with reference to the appended drawings.

Fig 1 is three-dimensional section view and shows a rotor for a VSI-crusher

Fig 2 is a three-dimensional view and shows the rotor of fig 1 with the upper disc removed.

Fig 3 shows the view of fig 2 as seen from above in a two dimensional perspective.

Fig 4 is a three-dimensional view of a wear tip and tip holder.

Fig 5 shows a part of a wall segment as seen from the inside, i.e. in the direction of arrow V in fig 3, of the rotor.

Fig 6 shows a part of a wall segment as seen from the outside of the rotor, i.e. in the direction of arrow VI in fig 3.

Fig 7 shows a tip holder according to another embodiment of a tip holder according to the invention.

Fig 8 is a three-dimensional view of still another embodiment of a tip holder according to the invention.

Detailed Description of Preferred Embodiments of the
10 Invention

Fig 1 shows a rotor 1 for use in a VSI-crusher. The rotor 1 has a roof in the form of an upper disc 2 having a top wear plate 3 and a floor in the form of a lower disc 4. The lower disc 4 has a hub 6, which is welded to
15 the disc 4. The hub 6 is to be connected to a shaft (not shown) for rotating the rotor 1 inside the housing of a VSI-crusher.

The upper disc 2 has a central opening 8 through which material to be crushed can be fed into the rotor 1.
20 The upper disc 2 is protected from wear by upper wear plates 10 and 12. The upper disc 2 is protected from rocks impacting the rotor 1 from above by the top wear plate 3. As is better shown in fig 2 the lower disc 4 is protected from wear by three lower wear plates 14, 16 and
25 18.

The upper and lower discs 2, 4 are separated by and held together by a vertical rotor wall which is separated into three wall segments 20, 22 and 24. The gaps between the wall segments 20, 22, 24 define outflow openings 26,
30 28, 30 through which material may be ejected against a housing wall.

At each outflow opening 26, 28, 30 the respective wall segment 20, 22, 24 is protected from wear by three wear tips 32, 34, 36 located at the trailing edge of the
35 respective wall segment 20, 22, 24.

A distributor plate 38 is fastened to the centre of the lower disc 4. The distributor plate 38 distributes

the material that is fed via the opening 8 in the upper disc 2 and protects the lower disc 4 from wear and impact damages caused by the material fed via the opening 8.

During operation of the rotor 1 a bed 40 of material is built up inside the rotor 1 against each of the three wall segments 20, 22, 24. In fig 3 only the bed 40 located adjacent to the wall segment 20 is shown. The bed 40, which consists of material that has been fed to the rotor 1 and then has been trapped inside it, extends from a rear support plate 42 to the wear tips 32, 34, 36. The bed 40 protects the wall segment 20 and the wear tips 32, 34, 36 from wear and provides a proper direction to the ejected material. The dashed arrow A describes a typical passage of a piece of rock fed to the rotor 1 via the central opening 8 and ejected via the outflow opening 26. The arrow R indicates the rotational direction of the rotor 1 during operation of the VSI-crusher.

Each wall segment 20, 22, 24 is provided with a cavity wear plate 44, 46, 48, each consisting of three cavity wear plate portions. The cavity wear plates 44, 46, 48 protects the rotor 1 and in particular the wear tips 32, 34, 36 from material rebounding from the housing wall and from ejected material and airborne fine dust spinning around the rotor 1.

In fig 4 a first embodiment of a tip holder 50 according to the invention is shown. The tip holder 50 has a holding part 52 shaped as a rectangular parallelepiped. The holding part 52 has a longitudinal recess 54 in which the wear tip 36 is located. The wear tip 36 may be welded or glued to the holding part 52. The holding part 52 has two hooks 56, 58. The two hooks 56, 58 are located at the opposite face of the holding part 52 in relation to the recess 54. A holding plate 60 is attached to the holding part 52. The holding plate 60, which is a flat rectangular plate, is attached to the holding part 52 at a position between the hooks 56, 58 and the recess 54. At an end of the plate 60, said end

being remote from the holding part 52, a round, threaded bar 62 is attached. The bar 62 is located in generally the same plane as the holding plate 60 and is perpendicular to the wear tip 36.

5 As can be seen in fig 4 the holding plate 60 has a smaller vertical extension than the holding part 52. Thereby an upper shoulder 64 and a lower shoulder 66 are formed at the respective transitions between the plate 60 and the part 52.

10 In fig 5 a part of the wall segment 20 as seen from the inside, i.e. in the direction of the arrow V in fig 3, is shown. The wall segment 20 comprises a first wall portion 20a which is substantially tangential to the disc 4 and thus the rotor 1. A second wall portion 20b is
15 fixed to the first portion 20a such that an "L" with an angle of about 120° is formed of the two portions 20a, 20b. The three wear tips, 32, 34, 36, each held by a tip holder 50, are attached to the wall 20 in such a way that
20 the wear tips 32, 34, 36 form a continuous, vertical row of wear tips. The second wall portion 20b is provided with holes 68, 70, 72 through which the round bar 62 of the respective tip holder 50 extends.

As can be seen in fig 5 the lower wear plate 14 is inserted under the lower shoulder 66 of the tip holder 50
25 holding the lower tip 32. This shoulder 66 thus assists in holding the wear plate 14 in place under the shoulder 66. The upper shoulder 64 (not shown in fig 5) of the tip holder 50 holding the upper wear tip 36 in place holds an upper wear plate in place in a similar manner. A
30 retractable pin 74 extending through the wall 20 further assists in holding the wear plate 14 in its proper position. Since the three tip holders 50 shown in fig 5 are identical they can replace each other. After some time of operation, usually causing most wear at the
35 centre wear tip 34, the tip holders 50 may be taken out and then put back again at new positions to enable more

hours of operation before the tips 32, 34, 36 are worn out.

Fig 6 shows a part of the rotor as seen from the outside, i.e. in the direction of the arrow VI in fig 3.

5 As can be seen the hooks 56, 58 of each tip holder 50 grips around the free vertical edge 76 of the first wall portion 20a. The threaded bar 62 of each tip holder 50 extends out of a hole 68, 70, 72 (of which only the hole 72 is indicated in fig 6) and is fixed towards the second
10 wall portion 20b by a nut 78.

When mounting a tip holder 50 of the type described above the tip holder 50 is first allowed to slide along the first wall portion 20a. Thus the plate 60 and the threaded bar 62 are guided in a direction parallel to the
15 first wall portion 20a until the hooks 56, 58 engage the free edge 76 and in such a way that the bar 62 passes through the hole 72. The nut 78 is screwed onto the part of the bar 62 extending on the outside of the second wall portion 20b. The nut 78 is a domed nut and thus protects
20 the end portion of the threaded bar 62 from wear and from being hit by rocks. The risk that the end portion of the threaded bar 62 would be damaged such that dismounting the nut 78 becomes difficult is thus minimized. The nut 78 is tightened such that a certain, desired tension is
25 obtained in the parts of the tip holder 50 that are located between the nut 78 and the hooks 56, 58. The nut 78 being located on the second wall portion 20b is protected by the first wall portion 20a from abrasive particles that often swirl around the rotor 1. Thus there
30 is a limited risk that the nut 78 is worn down during operation of the crusher.

When a worn tip holder 50 is to be replaced a bed of material 40 has built up against the inside of the wall segment 20. The worn tip holder 50 may be released
35 according to the following method. Firstly the nut 78 is unscrewed a few turns such that it is not tightly fixed to the bar 62. A hammer or similar tool is used to imply

a force or a strike on the nut 78 and thus to the end part of the threaded bar 62 in the direction shown with an arrow H in fig 6. The nut 78 thus serve as a surface for implying the force or strike. The force or strike
5 makes the tip holder 50, and in particular the threaded bar 62 and the plate 60, release from the often well compacted material bed 40. The nut 78 is then removed from the bar 62 such that the tip holder 50 may be taken away by guiding it away from the second wall portion 20b
10 in a direction, which is indicted by an arrow D in fig 6, being substantially parallel to the first wall portion 20a. Thus a time consuming process of removing the bed 40 before dismounting the tip holder 50 may be avoided.

In fig 7 another embodiment of the invention in the
15 form of a tip holder 100 is shown as seen from the inside of a rotor 1. The main differences compared to the tip holder 50 shown in fig 4 is that the tip holder 100 has a wide holding plate 160 and two threaded bars 161 and 162. The threaded bars 161, 162 extend through holes 168,
20 170 respectively, in the second wall portion 20b. The tip holder 100 has an upper shoulder 164 and a lower shoulder 166 for abutting against an upper wear plate (not shown) and a lower wear plate 14 respectively. A wear tip 136 located in a recess 154 of a holding part 152 extends
25 over the whole vertical distance of the outflow opening. The tip holder 100 is mainly used for rotors 1 of smaller vertical extension and for rotors 1 were the mutual exchangeability of the tip holders 50 described above is not desired.

30 In fig 8 yet another embodiment of the invention in the form of a tip holder 200 is shown. The main differences between the tip holder 200 and the tip holder 50 shown in figure 4 is that the tip holder 200 has no holding plate and that threaded bars 261, 262 are
35 attached directly to a holding part 252. The open space formed between the bars 261, 262 forms a material pocket. When such a tip holder 200 is attached to a rotor 1 the

amount of material and the size of material that may be trapped in the bed 40 just behind the holding part 252 is increased. A wear tip 236 is fixed in a recess 254 of the holding part 252. The holding part 252 has two hooks 256, 258 for securing it to the vertical free edge 76 of the first wall portion 20a. The bars 261, 262 may have the additional function of acting as shoulders for holding horizontal wear plates in the correct position.

10 It will be appreciated that numerous modifications of the embodiments described above are possible within the scope of the appended claims.

The tip holder may be applied both to wall segments consisting of one physical sheet of metal that has been bent to form a first and a second wall portion and to wall segments where the first and second wall portions are made of separate pieces.

20 In an alternative embodiment the hooks 56, 58 are broadened such that the two hooks together form an elongated, continuous flange extending along the entire length of the holding part 52. Such a flange would thus grip the entire free edge 76 of the first wall portion 20a and thus provide a very firm fastening of the tip holder.

25 The two hooks 56, 58, or the above mentioned flange, may also extend further along the first wall portion 20a in the direction of the second wall portion 20b.

CLAIMS

1. A tip holder for mounting at an outflow opening
5 (26) of a rotor (1) of a vertical shaft impact crusher,
said rotor (1) comprising a vertical rotor wall segment
(20) having a first wall portion (20a) being
substantially tangential in relation to the rotor (1) and
a second wall portion (20b) being angled in relation to
10 said first wall portion, said tip holder (50; 100; 200)
comprising
a holding part (52; 152; 252) for holding a wear tip
(36; 136; 236),
c h a r a c t e r i s e d in that
15 a fastening means (60, 62; 160, 162; 262) is
attached to the holding part (52; 152; 252), the
fastening means (60, 62; 160, 162; 262) being adapted to
extend along said first wall portion (20a) and through
said second wall portion (20b) from one side thereof, a
20 fixing means (78) being detachably fixable to the
fastening means (62; 162; 262) at the other side of said
second wall portion (20b).
2. A tip holder according to claim 1, wherein the
fastening means (60, 62; 160, 161, 162; 261, 262) extends
25 along the radially inner side of said first wall portion
(20a).
3. A tip holder according any one of claims 1 and 2,
wherein the tip holder (50; 200) comprises a securing
means (56, 58; 256, 258) for removably securing the tip
30 holder (50; 200) to a free vertical edge (76) of said
first wall portion (20a).
4. A tip holder according to claim 3, wherein said
securing means comprises a hook (56, 58; 256, 258)
adapted for gripping said edge (76) of said first wall
35 portion (20a).
5. A tip holder according to claim 2, wherein the
fastening means (60; 160) comprises at least one shoulder

(64, 66; 164, 166) adapted to hold a horizontal wear plate (10, 14) in position.

5 6. A tip holder according to claim 5, wherein the fastening means (60; 160) comprises a lower shoulder (66; 166) and an upper shoulder (64; 164) each being adapted to hold a horizontal wear plate (10, 14) in position.

7. A tip holder according to any one of the preceding claims, wherein the fastening means comprises a threaded bar (62; 161, 162; 261, 262) intended for
10 extending along said first wall portion (20a) and through a hole (68, 70, 72; 168, 170) in said second wall portion (20b).

8. A tip holder according to claim 7, wherein the fixing means comprises a nut (78) which is adapted to
15 provide a tensile stress in the threaded bar (62) when fixing said fixing means to the threaded bar (62) at said other side of the second wall portion (20b).

9. A tip holder according to any one of the preceding claims, wherein the fastening means comprises a
20 surface (78, 62) adapted for the application of a force in a direction parallel to said first wall portion (20a).

10. A method of mounting a tip holder to an outflow opening (26) of a rotor (1) of a vertical shaft impact crusher, said rotor (1) comprising a vertical rotor wall
25 segment (20) having a first wall portion (20a) being substantially tangential in relation to the rotor (1) and a second wall portion (20b) being angled in relation to said first wall portion (20a), said tip holder (50; 100; 200) comprising

30 a holding part (52; 152; 252) for holding a wear tip (36; 136; 236),

c h a r a c t e r i s e d i n t h a t

the tip holder (50; 100; 200) is guided along said first wall portion (20a) such that a fastening means (60, 62; 160, 161, 162; 261, 262) attached to the holding part
35 (52; 152; 252) extends along said first wall portion

15

(20a) and passes through said second wall portion (20b) from one side thereof, and

a fixing means (78) is fixed to the fastening means (62; 161, 162; 261, 262) at the other side of said second
5 wall portion (20b).

10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
841
842
843
844
845
846
847
848
849
850
851
852
853
854
855
856
857
858
859
860
861
862
863
864
865
866
867
868
869
870
871
872
873
874
875
876
877
878
879
880
881
882
883
884
885
886
887
888
889
890
891
892
893
894
895
896
897
898
899
900
901
902
903
904
905
906
907
908
909
910
911
912
913
914
915
916
917
918
919
920
921
922
923
924
925
926
927
928
929
930
931
932
933
934
935
936
937
938
939
940
941
942
943
944
945
946
947
948
949
950
951
952
953
954
955
956
957
958
959
960
961
962
963
964
965
966
967
968
969
970
971
972
973
974
975
976
977
978
979
980
981
982
983
984
985
986
987
988
989
990
991
992
993
994
995
996
997
998
999
1000
1001
1002
1003
1004
1005
1006
1007
1008
1009
1010
1011
1012
1013
1014
1015
1016
1017
1018
1019
1020
1021
1022
1023
1024
1025
1026
1027
1028
1029
1030
1031
1032
1033
1034
1035
1036
1037
1038
1039
1040
1041
1042
1043
1044
1045
1046
1047
1048
1049
1050
1051
1052
1053
1054
1055
1056
1057
1058
1059
1060
1061
1062
1063
1064
1065
1066
1067
1068
1069
1070
1071
1072
1073
1074
1075
1076
1077
1078
1079
1080
1081
1082
1083
1084
1085
1086
1087
1088
1089
1090
1091
1092
1093
1094
1095
1096
1097
1098
1099
1100
1101
1102
1103
1104
1105
1106
1107
1108
1109
1110
1111
1112
1113
1114
1115
1116
1117
1118
1119
1120
1121
1122
1123
1124
1125
1126
1127
1128
1129
1130
1131
1132
1133
1134
1135
1136
1137
1138
1139
1140
1141
1142
1143
1144
1145
1146
1147
1148
1149
1150
1151
1152
1153
1154
1155
1156
1157
1158
1159
1160
1161
1162
1163
1164
1165
1166
1167
1168
1169
1170
1171
1172
1173
1174
1175
1176
1177
1178
1179
1180
1181
1182
1183
1184
1185
1186
1187
1188
1189
1190
1191
1192
1193
1194
1195
1196
1197
1198
1199
1200
1201
1202
1203
1204
1205
1206
1207
1208
1209
1210
1211
1212
1213
1214
1215
1216
1217
1218
1219
1220
1221
1222
1223
1224
1225
1226
1227
1228
1229
1230
1231
1232
1233
1234
1235
1236
1237
1238
1239
1240
1241
1242
1243
1244
1245
1246
1247
1248
1249
1250
1251
1252
1253
1254
1255
1256
1257
1258
1259
1260
1261
1262
1263
1264
1265
1266
1267
1268
1269
1270
1271
1272
1273
1274
1275
1276
1277
1278
1279
1280
1281
1282
1283
1284
1285
1286
1287
1288
1289
1290
1291
1292
1293
1294
1295
1296
1297
1298
1299
1300
1301
1302
1303
1304
1305
1306
1307
1308
1309
1310
1311
1312
1313
1314
1315
1316
1317
1318
1319
1320
1321
1322
1323
1324
1325
1326
1327
1328
1329
1330
1331
1332
1333
1334
1335
1336
1337
1338
1339
1340
1341
1342
1343
1344
1345
1346
1347
1348
1349
1350
1351
1352
1353
1354
1355
1356
1357
1358
1359
1360
1361
1362
1363
1364
1365
1366
1367
1368
1369
1370
1371
1372
1373
1374
1375
1376
1377
1378
1379
1380
1381
1382
1383
1384
1385
1386
1387
1388
1389
1390
1391
1392
1393
1394
1395
1396
1397
1398
1399
1400
1401
1402
1403
1404
1405
1406
1407
1408
1409
1410
1411
1412
1413
1414
1415
1416
1417
1418
1419
1420
1421
1422
1423
1424
1425
1426
1427
1428
1429
1430
1431
1432
1433
1434
1435
1436
1437
1438
1439
1440
1441
1442
1443
1444
1445
1446
1447
1448
1449
1450
1451
1452
1453
1454
1455
1456
1457
1458
1459
1460
1461
1462
1463
1464
1465
1466
1467
1468
1469
1470
1471
1472
1473
1474
1475
1476
1477
1478
1479
1480
1481
1482
1483
1484
1485
1486
1487
1488
1489
1490
1491
1492
1493
1494
1495
1496
1497
1498
1499
1500
1501
1502
1503
1504
1505
1506
1507
1508
1509
1510
1511
1512
1513
1514
1515
1516
1517
1518
1519
1520
1521
1522
1523
1524
1525
1526
1527
1528
1529
1530
1531
1532
1533
1534
1535
1536
1537
1538
1539
1540
1541
1542
1543
1544
1545
1546
1547
1548
1549
1550
1551
1552
1553
1554
1555
1556
1557
1558
1559
1560
1561
1562
1563
1564
1565
1566
1567
1568
1569
1570
1571
1572
1573
1574
1575
1576
1577
1578
1579
1580
1581
1582
1583
1584
1585
1586
1587
1588
1589
1590
1591
1592
1593
1594
1595
1596
1597
1598
1599
1600
1601
1602
1603
1604
1605
1606
1607
1608
1609
1610
1611
1612
1613
1614
1615
1616
1617
1618
1619
1620
1621
1622
1623
1624
1625
1626
1627
1628
1629
1630
1631
1632
1633
1634
1635
1636
1637
1638
1639
1640
1641
1642
1643
1644
1645
1646
1647
1648
1649
1650
1651
1652
1653
1654
1655
1656
1657
1658
1659
1660
1661
1662
1663
1664
1665
1666
1667
1668
1669
1670
1671
1672
1673
1674
1675
1676
1677
1678
1679
1680
1681
1682
1683
1684
1685
1686
1687
1688
1689
1690
1691
1692
1693
1694
1695
1696
1697
1698
1699
1700
1701
1702
1703
1704
1705
1706
1707
1708
1709
1710
1711
1712
1713
1714
1715
1716
1717
1718
1719
1720
1721
1722
1723
1724
1725
1726
1727
1728
1729
1730
1731
1732
1733
1734
1735
1736
1737
1738
1739
1740
1741
1742
1743
1744
1745
1746
1747
1748
1749
1750
1751
1752
1753
1754
1755
1756
1757
1758
1759
1760
1761
1762
1763
1764
1765
1766
1767
1768
1769
1770
1771
1772
1773
1774
1775
1776
1777
1778
1779
1780
1781
1782
1783
1784
1785
1786
1787
1788
1789
1790
1791
1792
1793
1794
1795
1796
1797
1798
1799
1800
1801
1802
1803
1804
1805
1806
1807
1808
1809
1810
1811
1812
1813
1814
1815
1816
1817
1818
1819
1820
1821
1822
1823
1824
1825
1826
1827
1828
1829
1830
1831
1832
1833
1834
1835
1836
1837
1838
1839
1840
1841
1842
1843
1844
1845
1846
1847
1848
1849
1850
1851
1852
1853
1854
1855
1856
1857
1858
1859
1860
1861
1862
1863
1864
1865
1866
1867
1868
1869
1870
1871
1872
1873
1874
1875
1876
1877
1878
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1890
1891
1892
1893
1894
1895

ABSTRACT

A rotor of a vertical shaft impact crusher comprises
5 a vertical rotor wall segment having a first wall portion
being substantially tangential in relation to the rotor
and a second wall portion being angled in relation to
said first wall portion. A tip holder (50) for mounting
at an outflow opening of such a rotor comprises a holding
10 part (52) for holding a wear tip (36). A fastening means
(60, 62) is attached to the holding part (52). The
fastening means (60, 62) is adapted to extend along said
first wall portion and through said second wall portion
from one side thereof. A fixing means is detachably
15 fixable to the fastening means (62) at the other side of
said second wall portion.

20

25

30

35

Elected for publication: Fig 4

1/4

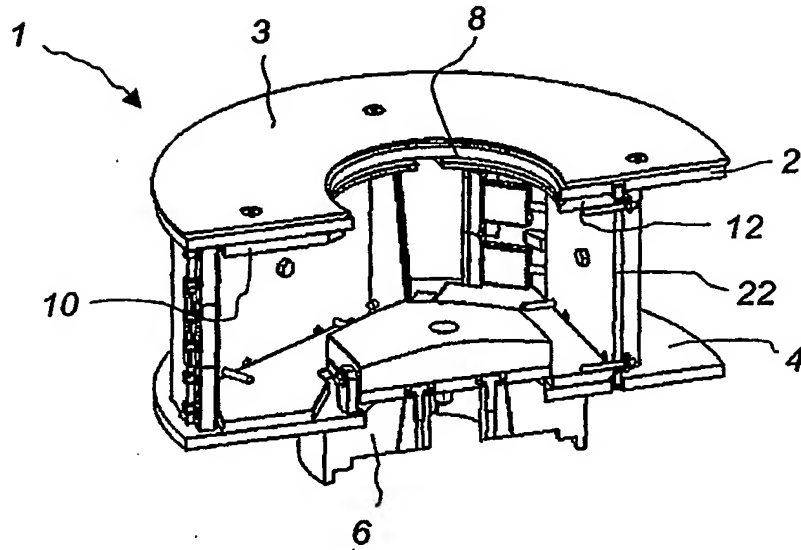


Fig. 1

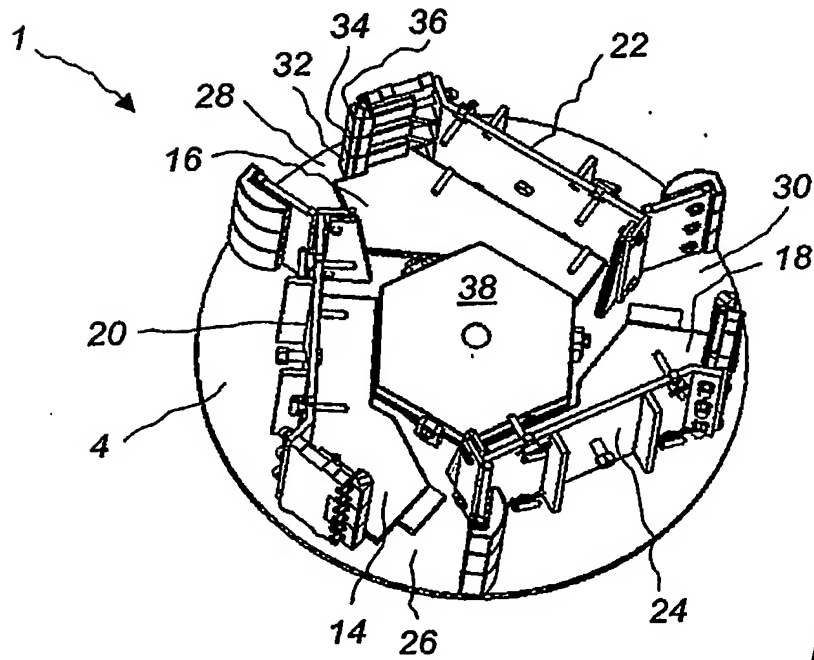


Fig. 2

2/4

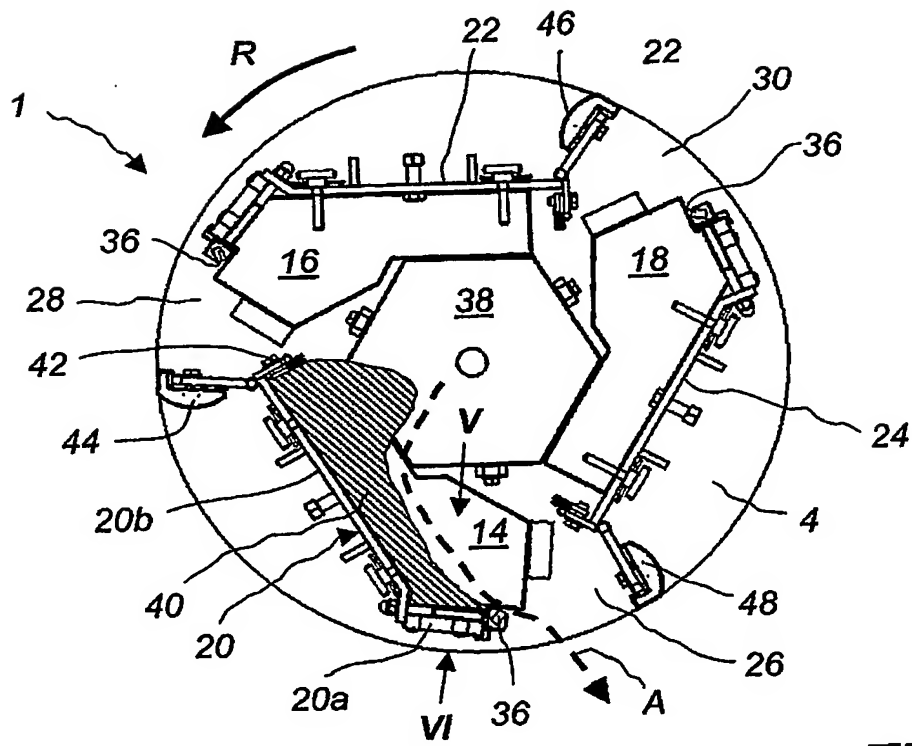


Fig. 3

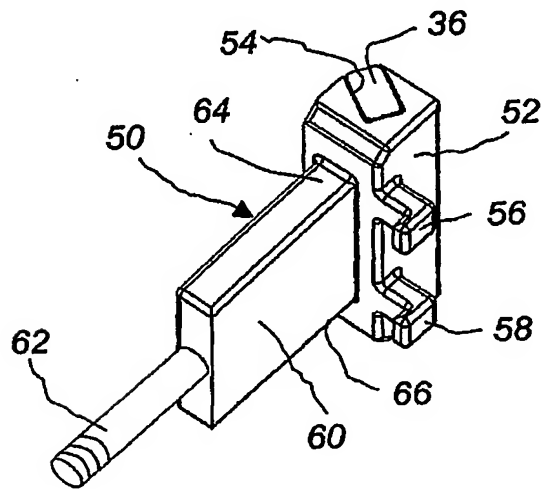


Fig. 4

3/4

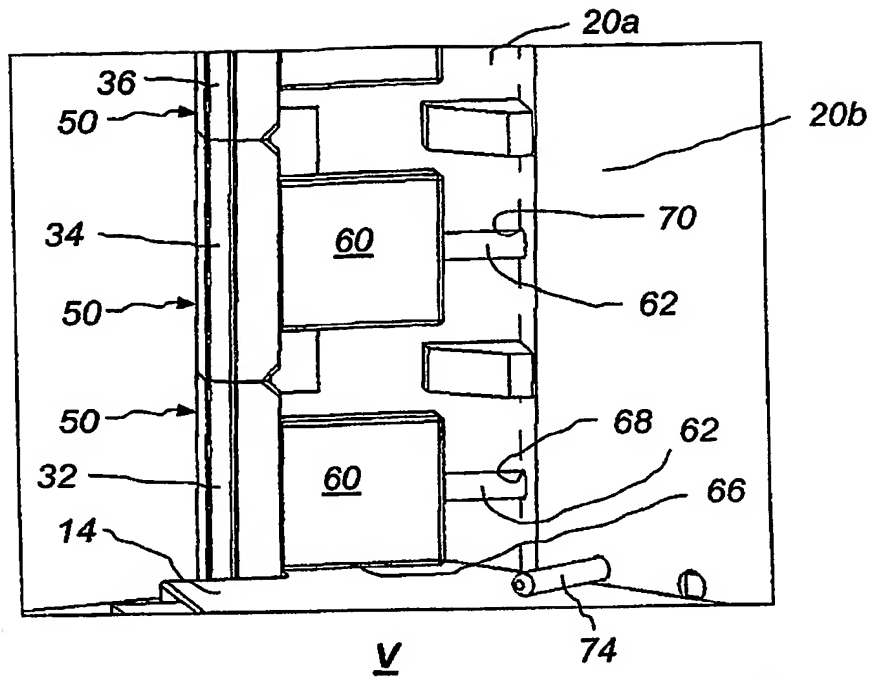


Fig. 5

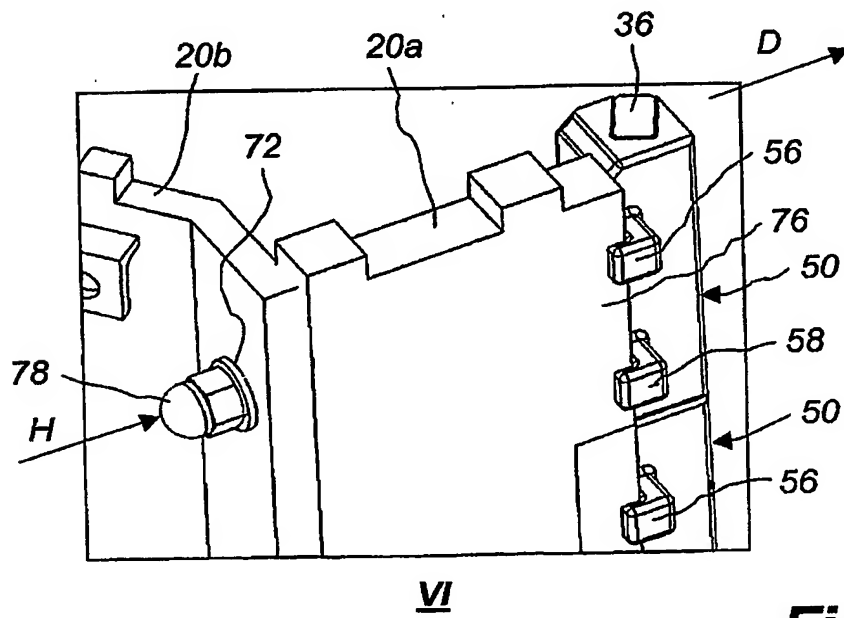


Fig. 6

4 / 4

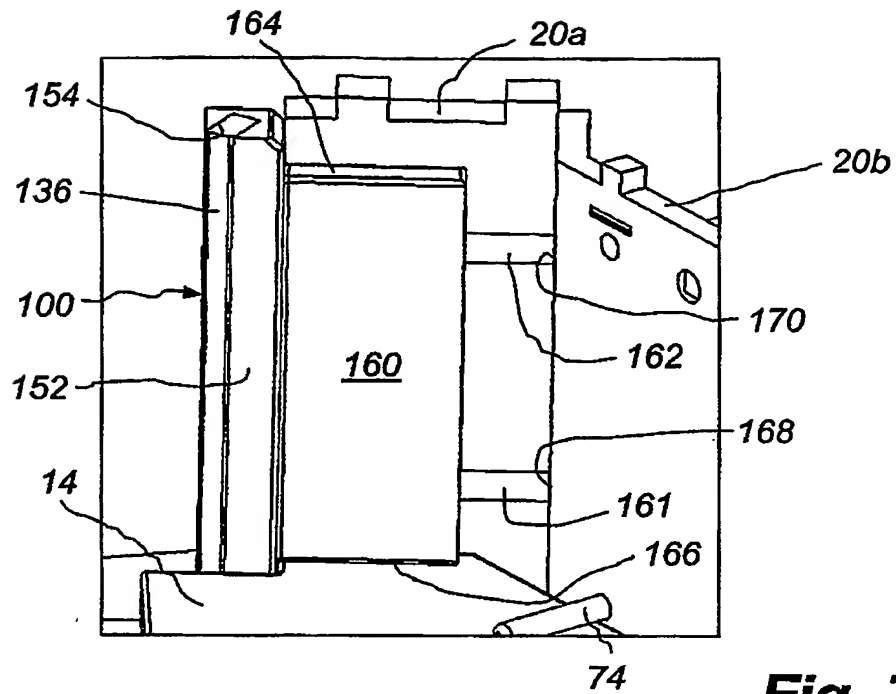


Fig. 7

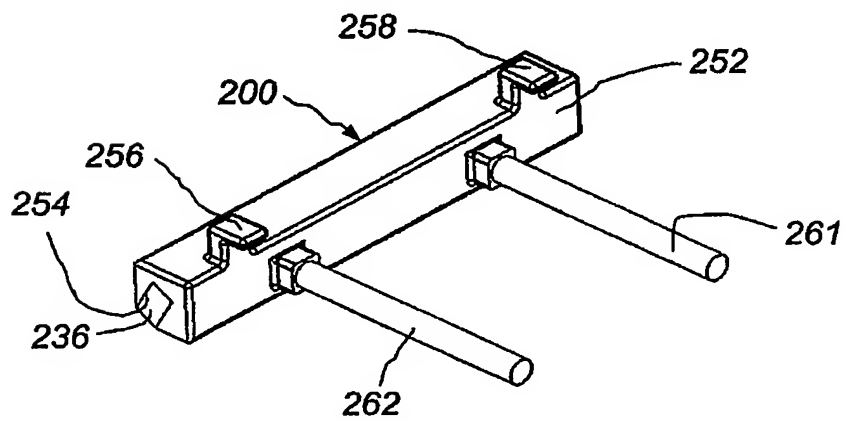


Fig. 8

**This Page is Inserted by IFW Indexing and Scanning
Operations and is not part of the Official Record**

BEST AVAILABLE IMAGES

Defective images within this document are accurate representations of the original documents submitted by the applicant.

Defects in the images include but are not limited to the items checked:

- ☐ **BLACK BORDERS**
- ☐ **IMAGE CUT OFF AT TOP, BOTTOM OR SIDES**
- ☐ **FADED TEXT OR DRAWING**
- ☐ **BLURRED OR ILLEGIBLE TEXT OR DRAWING**
- ☐ **SKEWED/SLANTED IMAGES**
- ☐ **COLOR OR BLACK AND WHITE PHOTOGRAPHS**
- ☐ **GRAY SCALE DOCUMENTS**
- ☐ **LINES OR MARKS ON ORIGINAL DOCUMENT**
- ☐ **REFERENCE(S) OR EXHIBIT(S) SUBMITTED ARE POOR QUALITY**
- ☐ **OTHER:** _____

IMAGES ARE BEST AVAILABLE COPY.

As rescanning these documents will not correct the image problems checked, please do not report these problems to the IFW Image Problem Mailbox.